



Where peripheral overlaps are too short the detail can be rectified by adding a suitably sized barrier insert piece and joining to the existing barrier panel as shown.

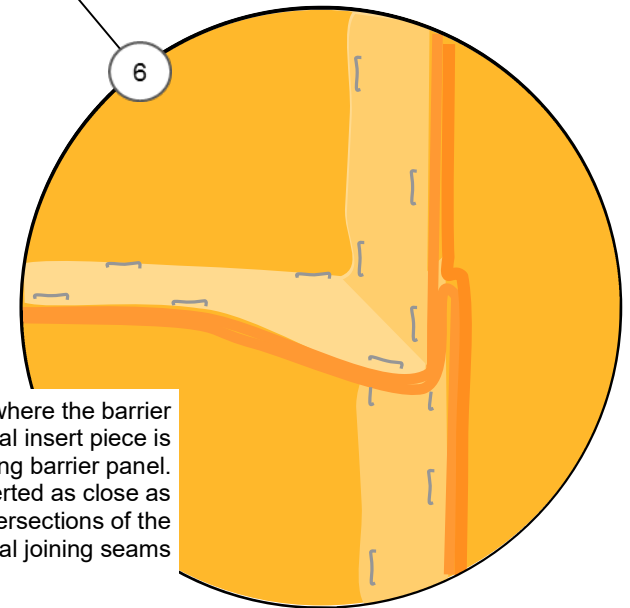

Vertical joint detail where the barrier panel with a remedial insert piece is rejoined to the existing barrier panel. Staples must be inserted as close as possible to the intersections of the horizontal/vertical joining seams

#	DESCRIPTION	NOTES
1	INCORRECT PERIPHERAL OVERLAPS	Too Short
2	50 X 25 x 0.7mm GALV ANGLE	Primary Fixing Angle
3	25 x 25 x 0.7mm GALV ANGLE	Clamping Angle
4	INSERTED SECTION OF BARRIER	To Provide Correct Length of Overlap
5	100mm OVERLAP	
6	50mm HORIZONTAL JOINING SEAM	See Standard Detail
7	SELF TAPPING SCREWS	250mm Centres

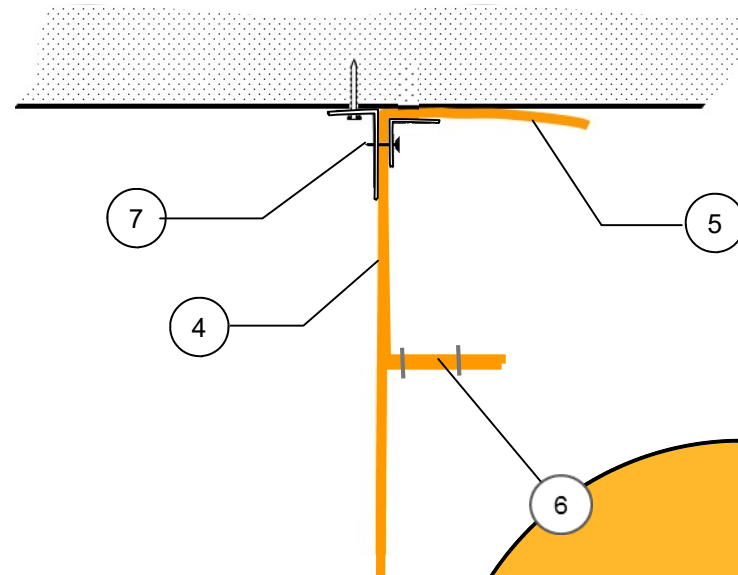

Tel : +44 (0)161 344 2484
 Fax : +44 (0)161 344 2486
 Email : sales@firehalt.com
 Web : www.firehalt.com

This fixing detail is for guidance purposes only. If in doubt seek approval from Building Control or another qualified person before installation

Title: Remedial Work (short peripheral overlaps)	Products: All Firehalt barriers	Fix Detail : # 12
		Version: 1
		Date: 18/12/2017